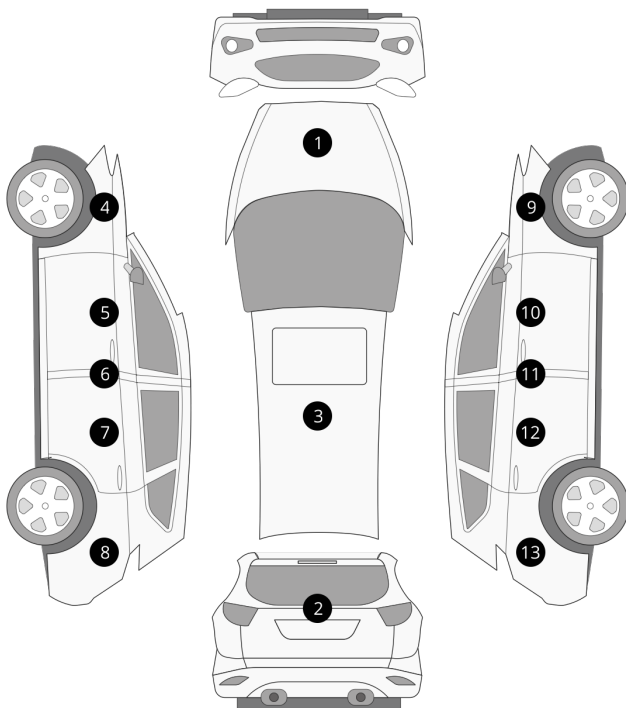


General Information

Date & Time: 01, Mar, 2024 13:34

Make	Suzuki	Model	Other
YOM	2018	Mileage	276,610
Registration No.	BLN-401	Chassis No.	NF1AVK31H10015823
CC	undefined	Transmission	Manual
Fuel Type	Petrol	Type of Body	Hatchback
Colour	White	Grade	undefined
Expiry Revenue license	06-04-2024	Expiry Insurance	06-04-2024

Body / Panel Condition



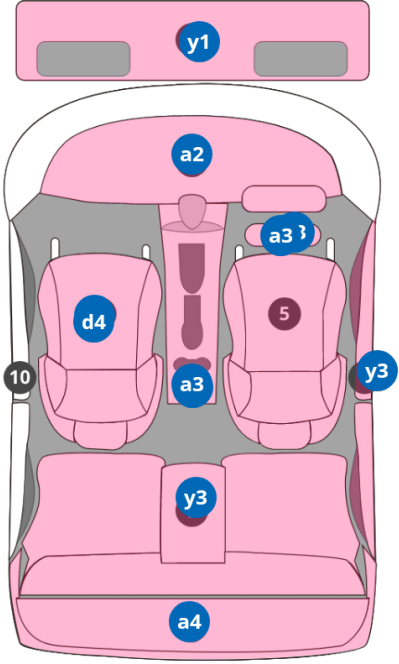
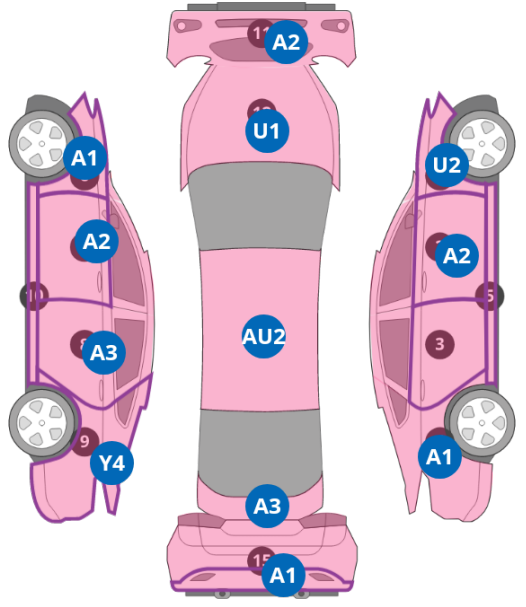
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	5.1	4	5	6
2	Boot Lid	4.3	4	5	4
3	Roof	4.2	4	5	4/4
4	Left Front Fender	9.3	5	6	16
5	Left Front Door	12.8	9	19	11
6	Center Panel Left				
7	Left Rear Door	4.3	5	4	4
8	Left Back Panel	4.1	4	4	4
9	Right Front Fender	4.5	4	5	5
10	Right Front Door	4.7	4	4	6
11	Center Panel Right				
12	Right Rear Door	13.8	28	6	7
13	Right Back Panel	5.3	4	6	5

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : B-
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Small / Carpet - Loose, Deformed, Grime - Medium / Right Front Floor Lag - Cut, Crack - Medium / Right Front Seat Knobs - Stuck - Yes / Right Front Trim - Grime - Medium / Left Front Seat - Grime - Minimal / Left Front Seat belt - Loose, Deformed, Grime - Large / Console - Worn, Scratch, Cut, Crack - Minimal / Knobs - Worn, Peel, Crack - Medium / Audio System - Stuck - Yes / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Large</p>	<p>Remarks Right Front Door - Repair Traces - Yes / Right Step and Side Spoiler - Repair Traces - Yes / Right Front Fender - Repair Traces - Yes / Left Front Fender - Repair Traces - Yes / Left Front Door - Repair Traces - Yes / Left Step and Side Spoiler - Repair Traces - Yes / Left Rear Door - Repair Traces - Yes / Left Rear Fender - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / Right Rear Door - Repair Traces - Yes / Right Front Fender - Dent - Small / Right Rear Door - Scratch - Small / Right Rear Fender - Scratch - Minimal / Left Front Fender - Scratch - Minimal / Left Front Door - Scratch - Small / Left Rear Door - Scratch - Medium / Left Rear Fender - Crack, Gap - Large / Roof - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / Bonnet, Headlight - Dent - Minimal / Front Bumper and Grille - Scratch - Small</p>
Frame Evaluation : C	Functional Evaluation : D
<p>Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Center Pillar - Condition of Welding ? - Yes</p>	<p>Remarks Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Wiper - Function - Weak</p>

Inspector Notes