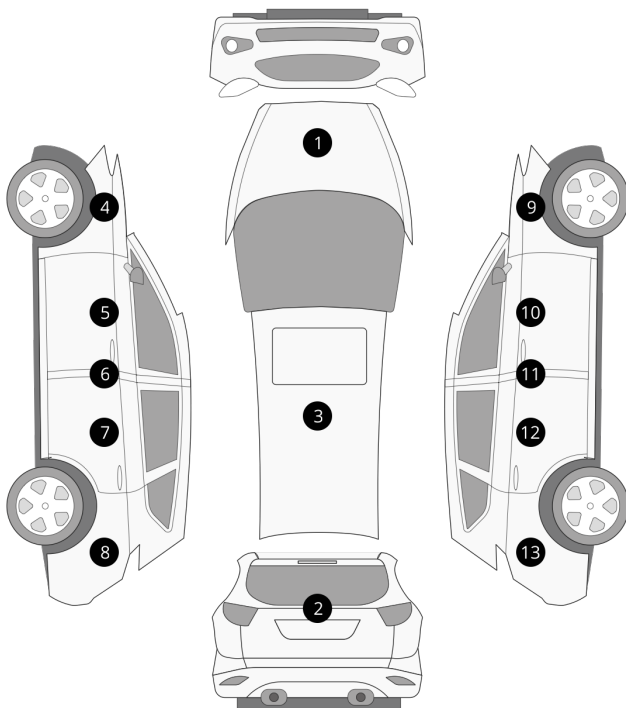


General Information

Date & Time: 02, Mar, 2024 10:09

Make	Suzuki	Model	Other
YOM	2008	Mileage	381,840
Registration No.	LED-08-1106	Chassis No.	421802
CC	undefined	Transmission	Manual
Fuel Type	Petrol	Type of Body	Hatchback
Colour	White	Grade	undefined
Expiry Revenue license	06-04-2024	Expiry Insurance	06-04-2024

Body / Panel Condition



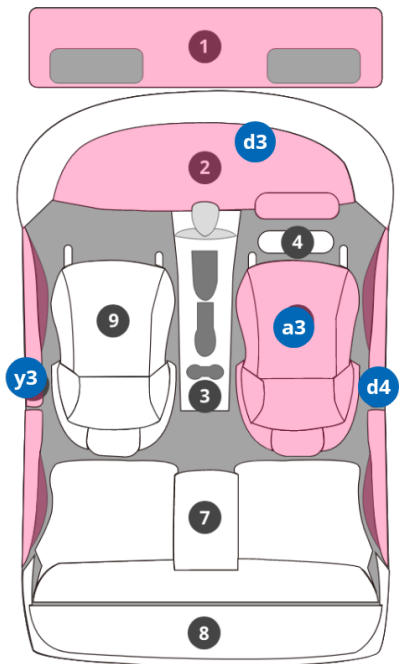
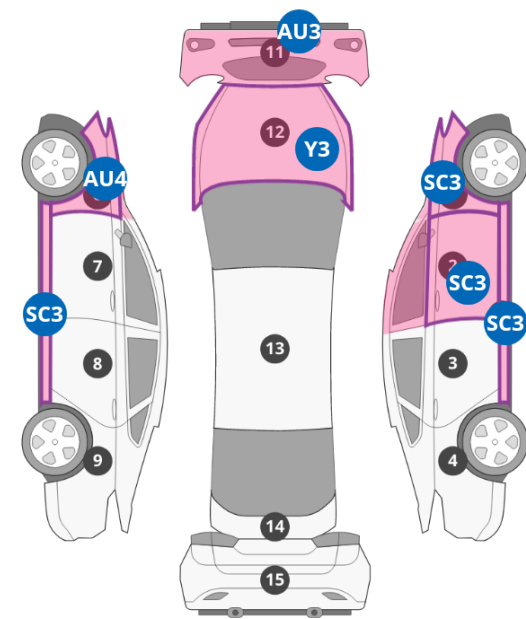
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	10.1	5	7	18
2	Boot Lid	16.6	31	13	6
3	Roof	3.9	3	4	5/4
4	Left Front Fender	8.9	14	6	7
5	Left Front Door	6.8	5	5	11
6	Center Panel Left				
7	Left Rear Door	10.9	15	11	7
8	Left Back Panel	6.2	6	5	8
9	Right Front Fender	36.8	24	38	48
10	Right Front Door	6.5	7	5	8
11	Center Panel Right				
12	Right Rear Door	13.3	22	10	8
13	Right Back Panel	29.4	33	24	31

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<p>Interior Evaluation : B-</p>	<p>Exterior Evaluation : B-</p>
<div style="text-align: center;">  </div> <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<div style="text-align: center;">  </div> <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Switches - Missing - Yes / Dashboard - Loose, Deformed, Grime - Medium / Right Front Trim - Loose, Deformed, Grime - Large / Left Front Trim - Grime - Medium / Right Front Seat - Cut, Crack - Medium</p>	<p>Remarks Right Front Door - Repair Traces - Yes / Right Step and Side Spoiler - Repair Traces - Yes / Right Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Left Front Fender - Repair Traces - Yes / Left Step and Side Spoiler - Repair Traces - Yes / Front Bumper and Grille - Scratch & Dent - Medium / Bonnet, Headlight - Crack, Gap - Medium / Right Front Fender - Rust, Corrosion - Medium / Right Front Wheel, Cover - Cap Missing - Yes / Right Front Door - Rust, Corrosion - Medium / Right Step and Side Spoiler - Rust, Corrosion - Medium / Left Front Fender - Scratch & Dent - Large / Left Step and Side Spoiler - Rust, Corrosion - Medium / Left Front Wheel, Cover - Cap Missing - Yes</p>
<p>Frame Evaluation : C</p>	<p>Functional Evaluation : D</p>
<p>Remarks Right Front Pillar - Condition of Welding ? - Yes</p>	<p>Remarks Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Brake Pedal - Function - Weak / Head Light, High Beam - Issue - Yes</p>

Inspector Notes