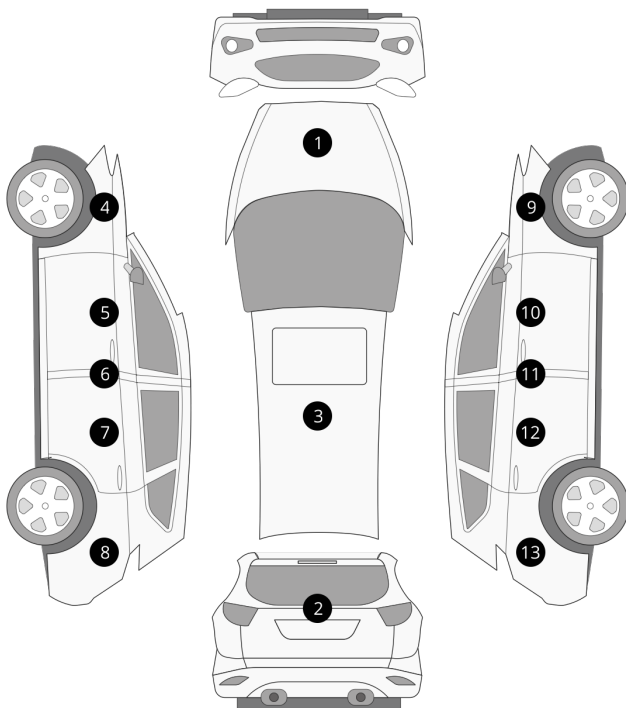


## General Information

Date & Time: 01, Mar, 2024 12:44

Make	Honda	Model	City
YOM	2012	Mileage	281,957
Registration No.	LEC-12-6983	Chassis No.	NFBGM1643CR129704
CC	1.3	Transmission	Automatic
Fuel Type	Petrol	Type of Body	Sedan/Saloon
Colour	Silver	Grade	undefined
Expiry Revenue license	30-03-2024	Expiry Insurance	06-04-2024

## Body / Panel Condition



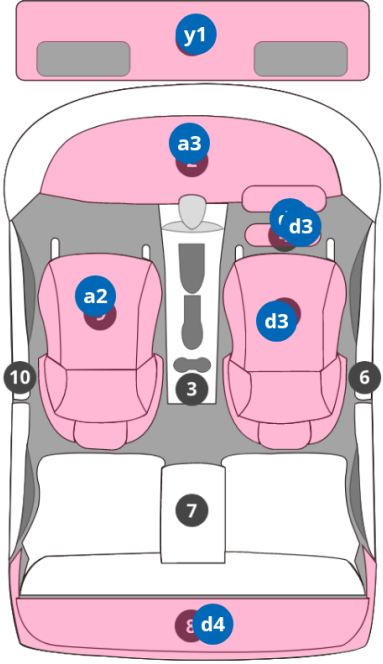
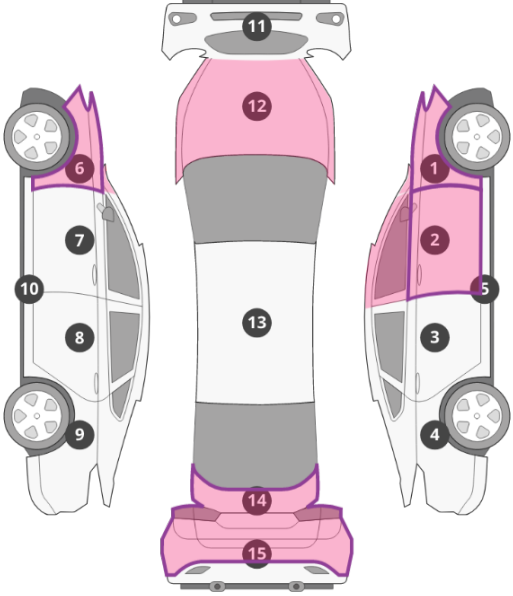
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	4.8	4	5	5
2	Boot Lid	2.9	3	3	3
3	Roof	2.5	3	3	2/3
4	Left Front Fender	6.0	5	6	7
5	Left Front Door	12.4	12	12	13
6	Center Panel Left				
7	Left Rear Door	24.3	21	24	28
8	Left Back Panel	23.4	28	29	14
9	Right Front Fender	8.4	7	7	11
10	Right Front Door	12.4	10	18	9
11	Center Panel Right				
12	Right Rear Door	16.7	15	21	14
13	Right Back Panel	35.1	37	25	43

Overall Evaluation :

**B**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B-</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>B+</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Minimal / Room Lamp - Stuck - Yes / Steering Wheel - Worn, Peel, Crack - Medium / Left Front Floor Lag - Crinkle - Medium / Right Front Floor Lag - Crinkle - Medium / Right Front Seat belt - Loose, Deformed, Grime - Medium / Left Front Seat belt - Cut, Crack - Small / Trunk Room - Loose, Deformed, Grime - Large</p>	<p><b>Remarks</b> Right Front Door - Repair Traces - Yes / Right Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Left Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>B-</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Battery - Weak - Yes / Wiper - Function - Weak / Seat Belts - Issue - Yes</p>

<p><b>Inspector Notes</b></p>