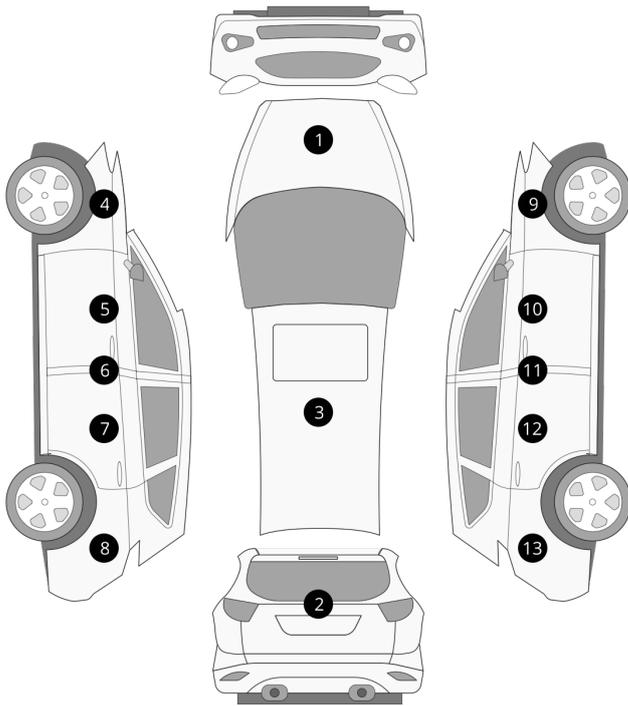


## General Information

Date & Time: 01, Mar, 2024 11:42

Make	Suzuki	Model	Other
YOM	2017	Mileage	263,800
Registration No.	LEB-17A-7542	Chassis No.	NF1AVK31H10010109
CC	undefined	Transmission	Manual
Fuel Type	Petrol	Type of Body	Hatchback
Colour	White	Grade	undefined
Expiry Revenue license	06-04-2024	Expiry Insurance	06-04-2024

## Body / Panel Condition



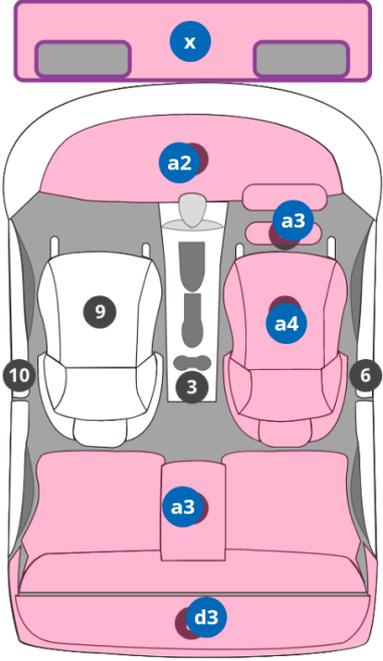
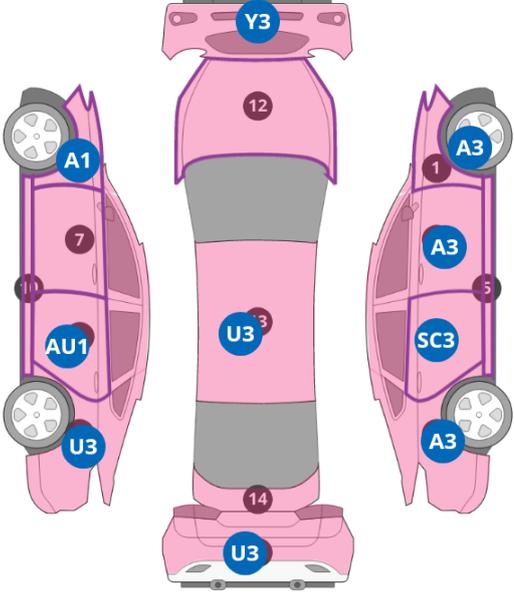
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	13.6	13	21	7
2	Boot Lid	4.8	6	4	4
3	Roof	4.2	5	4	4/4
4	Left Front Fender	12.6	14	19	5
5	Left Front Door	10.8	13	8	12
6	Center Panel Left				
7	Left Rear Door	13.0	16	10	13
8	Left Back Panel	39.9	46	34	40
9	Right Front Fender	3.9	6	5	1
10	Right Front Door	5.5	8	4	5
11	Center Panel Right				
12	Right Rear Door	11.0	5	4	24
13	Right Back Panel	24.0	37	25	10

Overall Evaluation :

**C**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B-</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>D</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Sunvisor - Missing - Yes / Steering Wheel - Worn, Peel, Crack - Small / Carpet - Worn, Scratch, Cut, Crack - Medium / Right Front Seat - Cut, Crack - Large / Overall Interior - Worn as per age - Yes / Rear Seat - Cut, Crack - Medium / Trunk Room - Loose, Deformed, Grime - Medium</p>	<p><b>Remarks</b> Right Step and Side Spoiler - Repair Traces - Yes / Right Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Left Front Fender - Repair Traces - Yes / Left Front Door - Repair Traces - Yes / Left Step and Side Spoiler - Repair Traces - Yes / Left Rear Door - Repair Traces - Yes / Right Rear Door - Repair Traces - Yes / Right Front Fender - Scratch - Medium / Right Front Door - Scratch - Medium / Right Rear Fender - Scratch - Medium / Right Rear Door - Rust, Corrosion - Medium / Bonnet, Headlight - Partially Missing - Yes / Left Rear Fender - Dent - Medium / Left Rear Door - Scratch &amp; Dent - Minimal / Left Front Fender - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Medium / Roof - Dent - Medium / Front Bumper and Grille - Crack, Gap - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B-</b></span>
<p><b>Remarks</b> Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes</p>	<p><b>Remarks</b> Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Head Light, High Beam - Issue - Yes / Wiper - Function - Weak</p>

<p><b>Inspector Notes</b></p>