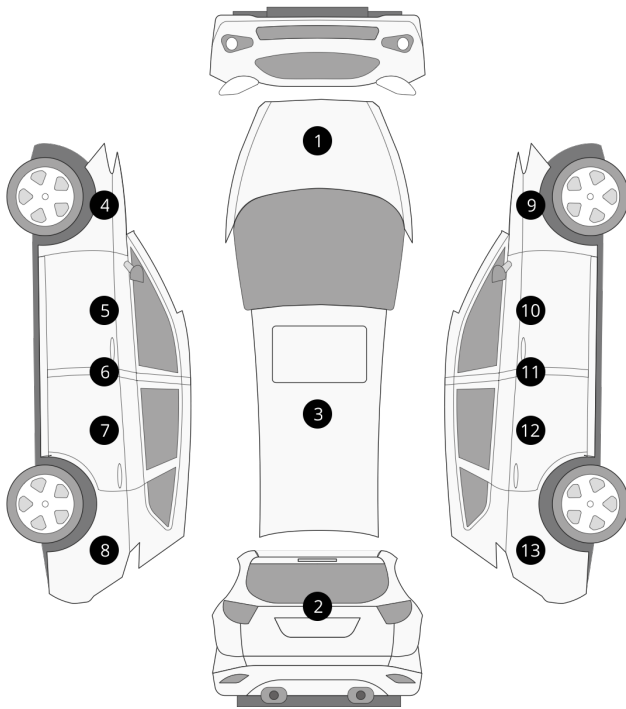


General Information

Date & Time: 02, Mar, 2024 09:53

Make	Suzuki	Model	Other
YOM	2018	Mileage	238,351
Registration No.	LEB-18-3088	Chassis No.	NF1AVK31H10016167
CC	undefined	Transmission	Manual
Fuel Type	Petrol	Type of Body	Hatchback
Colour	White	Grade	undefined
Expiry Revenue license	06-04-2024	Expiry Insurance	06-04-2024

Body / Panel Condition



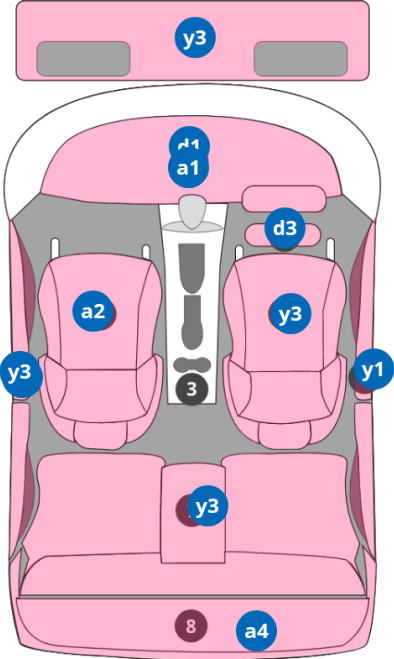
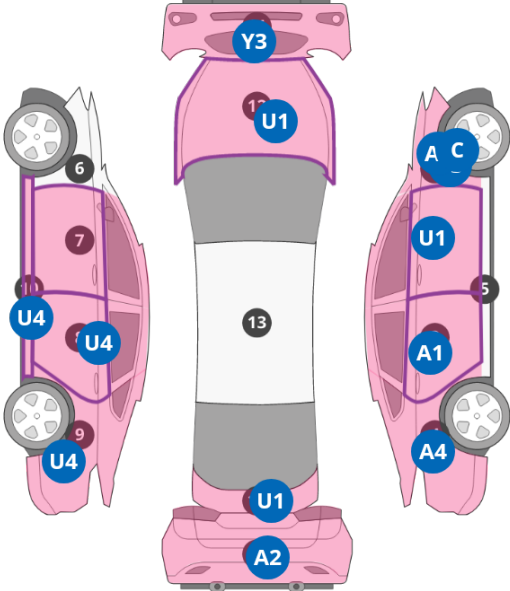
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	24.3	22	14	38
2	Boot Lid	2.8	0	4	4
3	Roof	2.0	4	0	0/4
4	Left Front Fender	16.0	13	19	16
5	Left Front Door	18.7	9	41	6
6	Center Panel Left				
7	Left Rear Door	6.5	6	9	5
8	Left Back Panel	2.3	6	1	0
9	Right Front Fender	46.6	40	50	50
10	Right Front Door	9.5	8	18	3
11	Center Panel Right				
12	Right Rear Door	11.0	9	9	15
13	Right Back Panel	8.3	8	8	9

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Dashboard - Loose, Deformed, Grime - Minimal / Glove Box - Worn, Scratch, Cut, Crack - Minimal / Carpet - Loose, Deformed, Grime - Medium / Right Front Seat - Grime - Medium / Left Front Seat - Cut, Crack - Small / Right Front Trim - Grime - Minimal / Left Front Trim - Grime - Medium / Left Rear Trim - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Large</p>	<p>Remarks Right Front Door - Repair Traces - Yes / Right Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Left Front Door - Repair Traces - Yes / Left Step and Side Spoiler - Repair Traces - Yes / Left Rear Door - Repair Traces - Yes / Right Rear Door - Repair Traces - Yes / Right Front Fender - Crack, Gap - Medium / Supplemental Mirror - Scratch, Peeled - Minimal / Right Front Wheel, Cover - Scratch, Corrosion - Bent / Right Front Door - Dent - Minimal / Right Rear Door - Scratch - Minimal / Right Rear Fender - Scratch - Large / Left Rear Fender - Dent - Large / Left Rear Door - Dent - Large / Left Step and Side Spoiler - Dent - Large / Front Bumper and Grille - Crack, Gap - Medium / Bonnet, Headlight - Dent - Minimal / Trunk Hood, Rear Gate - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small</p>
Frame Evaluation : B-	Functional Evaluation : B-
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Wiper - Function - Weak</p>

<p>Inspector Notes</p>