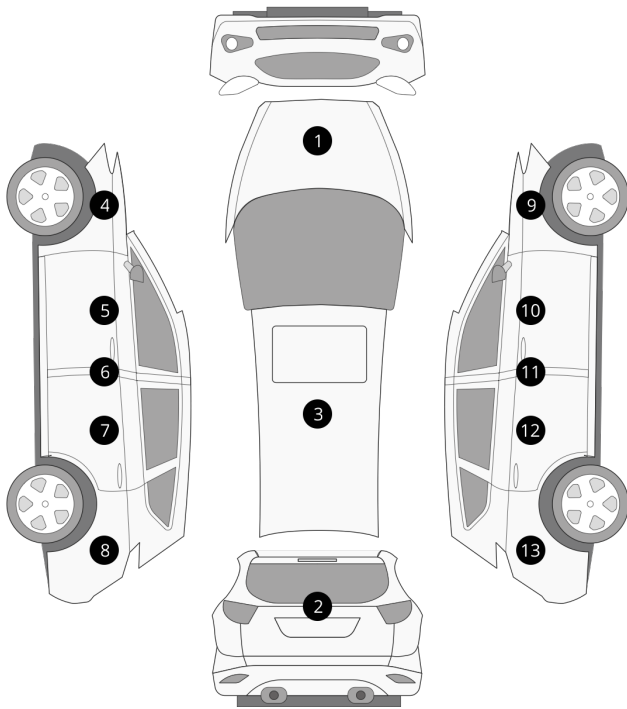


## General Information

Date & Time: 15, Feb, 2024 17:10

Make	Suzuki	Model	Other
YOM	2016	Mileage	44,409
Registration No.	BGP-120	Chassis No.	SF410PK533004
CC	undefined	Transmission	Manual
Fuel Type	Petrol	Type of Body	Hatchback
Colour	Gold	Grade	undefined
Expiry Revenue license	15-03-2024	Expiry Insurance	15-03-2024

## Body / Panel Condition



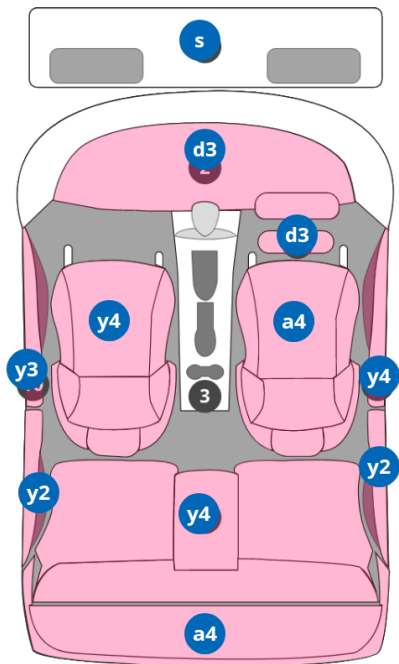
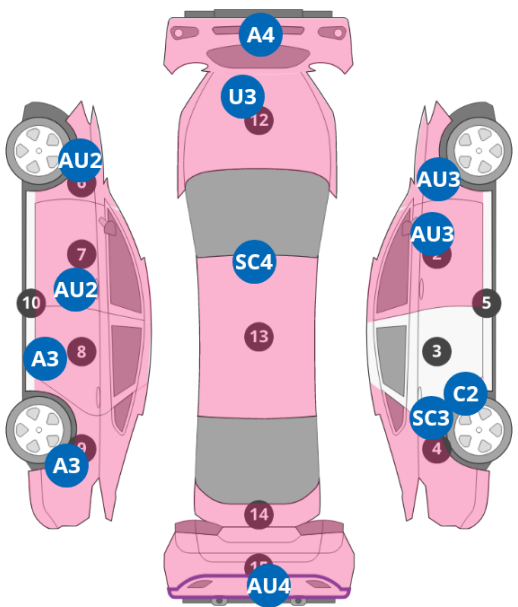
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	4.8	4	6	4
2	Boot Lid	4.3	4	5	5
3	Roof	3.7	4	5	2/4
4	Left Front Fender	5.1	5	5	5
5	Left Front Door	3.4	3	3	3
6	Center Panel Left				
7	Left Rear Door	2.5	4	4	0
8	Left Back Panel	4.5	5	4	4
9	Right Front Fender	4.0	4	4	4
10	Right Front Door	8.1	10	7	7
11	Center Panel Right				
12	Right Rear Door	15.6	15	16	16
13	Right Back Panel	12.4	12	11	15

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>D</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / Dashboard - Loose, Deformed, Grime - Medium / Right Front Floor Lag - Loose, Deformed, Grime - Medium / Right Front Seat - Cut, Crack - Large / Right Front Trim - Grime - Large / Right Rear Trim - Grime - Small / Rear Seat - Grime - Large / Left Front Seat - Grime - Large / Left Front Trim - Grime - Medium / Left Rear Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Large</p>	<p><b>Remarks</b> Right Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / Right Front Fender - Scratch &amp; Dent - Medium / Right Front Door - Scratch &amp; Dent - Medium / Right Rear Wheel, Cover - Scratch, Corrosion - Small / Right Rear Fender - Rust, Corrosion - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Left Rear Fender - Scratch - Medium / Left Rear Door - Scratch - Medium / Left Front Door - Scratch &amp; Dent - Small / Left Front Fender - Scratch &amp; Dent - Small / Roof - Rust, Corrosion - Large / Bonnet, Headlight - Dent - Medium / Front Bumper and Grille - Scratch - Large</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>B-</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B-</b></span>
<p><b>Remarks</b> Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Door Lock - Issue - Yes / Air Conditioner - Function - Weak / Audio, Radio - Issue - Yes / Wiper - Function - Weak</p>

<p><b>Inspector Notes</b></p>
<p>car is rusted from some parts and have a lot of smell</p>