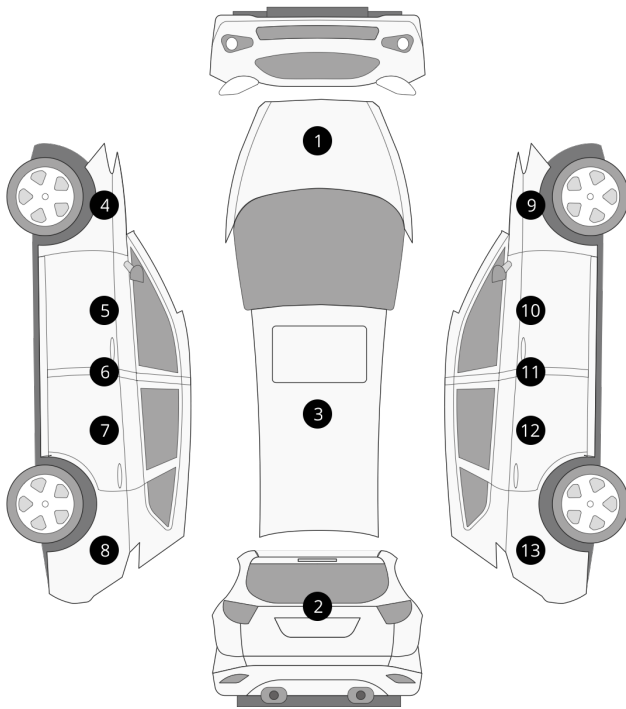


General Information

Date & Time: 01, Mar, 2024 18:47

| | | | |
|------------------------|------------|------------------|---------------|
| Make | Toyota | Model | Corolla |
| YOM | 2011 | Mileage | 295,141 |
| Registration No. | LE-11-1344 | Chassis No. | NZE1402121258 |
| CC | undefined | Transmission | Manual |
| Fuel Type | Petrol | Type of Body | Sedan/Saloon |
| Colour | Black | Grade | undefined |
| Expiry Revenue license | 06-04-2024 | Expiry Insurance | 06-04-2024 |

Body / Panel Condition



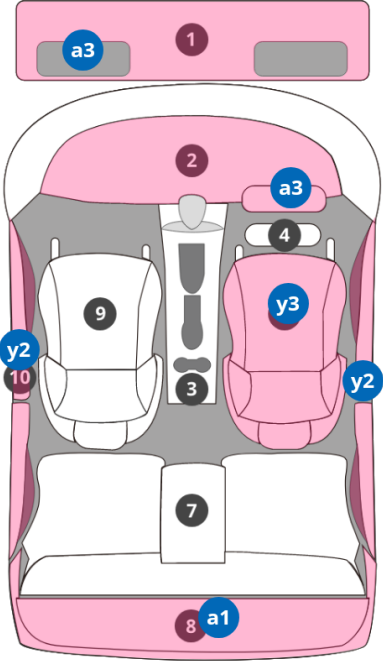
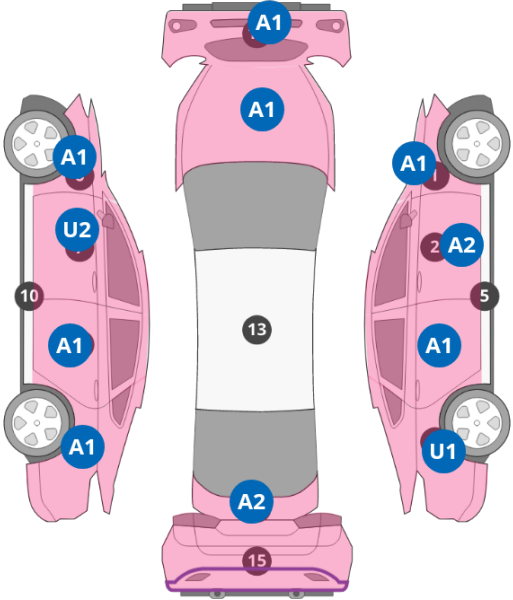
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 4.0 | 5 | 4 | 3 |
| 2 | Boot Lid | 5.2 | 5 | 5 | 6 |
| 3 | Roof | 3.4 | 3 | 3 | 3/5 |
| 4 | Left Front Fender | 16.9 | 18 | 12 | 21 |
| 5 | Left Front Door | 10.0 | 10 | 11 | 10 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 25.6 | 22 | 20 | 36 |
| 8 | Left Back Panel | 10.4 | 16 | 7 | 9 |
| 9 | Right Front Fender | 25.7 | 24 | 33 | 21 |
| 10 | Right Front Door | 9.6 | 10 | 8 | 11 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 9.2 | 9 | 9 | 10 |
| 13 | Right Back Panel | 9.0 | 7 | 8 | 12 |

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

| | |
|---|---|
| Interior Evaluation : B- | Exterior Evaluation : B |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks Sunvisor - Cut, Crack - Minimal / Steering Wheel - Worn, Peel, Crack - Medium / Right Front Seat - Grime - Medium / Left Front Trim - Grime - Medium / Right Front Trim - Grime - Medium / Console - Loose, Deformed, Grime - Minimal / Trunk Room - Loose, Deformed, Grime - Medium</p> | <p>Remarks Front Bumper and Grille - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Right Front Fender - Scratch - Minimal / Right Front Door - Scratch - Small / Right Rear Door - Scratch - Minimal / Right Rear Fender - Dent - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / Left Rear Door - Scratch - Minimal / Left Rear Fender - Scratch - Minimal / Left Front Door - Dent - Small / Left Front Fender - Scratch - Minimal</p> |
| Frame Evaluation : B+ | Functional Evaluation : D |
| <p>Remarks Defects not found</p> | <p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak</p> |

| |
|-------------------------------|
| <p>Inspector Notes</p> |
| |