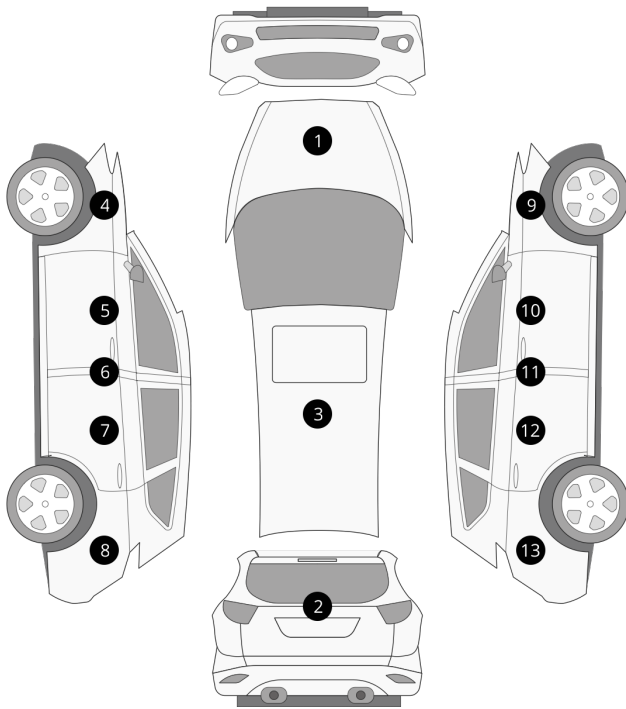


General Information

Date & Time: 15, Feb, 2024 15:45

Make	Toyota	Model	Corolla
YOM	2009	Mileage	36,756
Registration No.	ASW-251	Chassis No.	ZZE1427403857
CC	undefined	Transmission	Automatic
Fuel Type	Petrol	Type of Body	Sedan/Saloon
Colour	Silver	Grade	undefined
Expiry Revenue license	16-03-2024	Expiry Insurance	16-03-2024

Body / Panel Condition



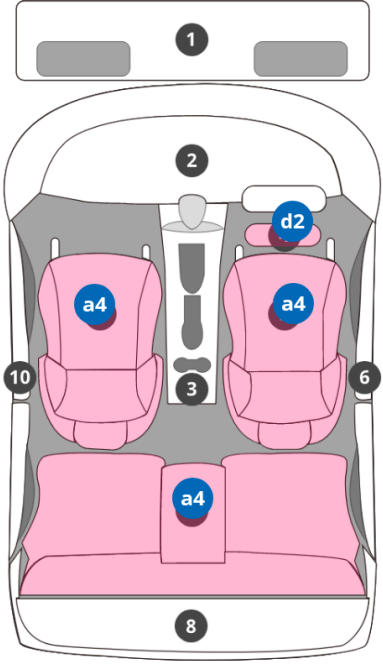
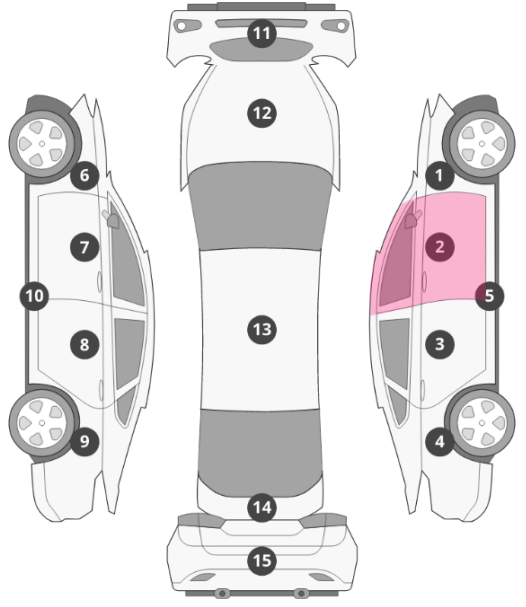
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	5.1	5	6	5
2	Boot Lid	4.6	5	5	4
3	Roof	3.4	0	5	5/5
4	Left Front Fender	5.3	6	6	5
5	Left Front Door	4.9	3	6	6
6	Center Panel Left				
7	Left Rear Door	8.7	14	6	6
8	Left Back Panel	6.3	6	6	8
9	Right Front Fender	5.7	5	6	7
10	Right Front Door	11.5	20	9	6
11	Center Panel Right				
12	Right Rear Door	5.6	6	6	6
13	Right Back Panel	5.0	4	6	6

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B-	Exterior Evaluation : B+
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Carpet - Loose, Deformed, Grime - Small / Right Front Seat - Cut, Crack - Large / Left Front Seat - Cut, Crack - Large / Rear Seat - Cut, Crack - Large</p>	<p>Remarks Right Front Door - Repair Traces - Yes</p>
Frame Evaluation : B+	Functional Evaluation : B-
<p>Remarks Defects not found</p>	<p>Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes</p>

Inspector Notes