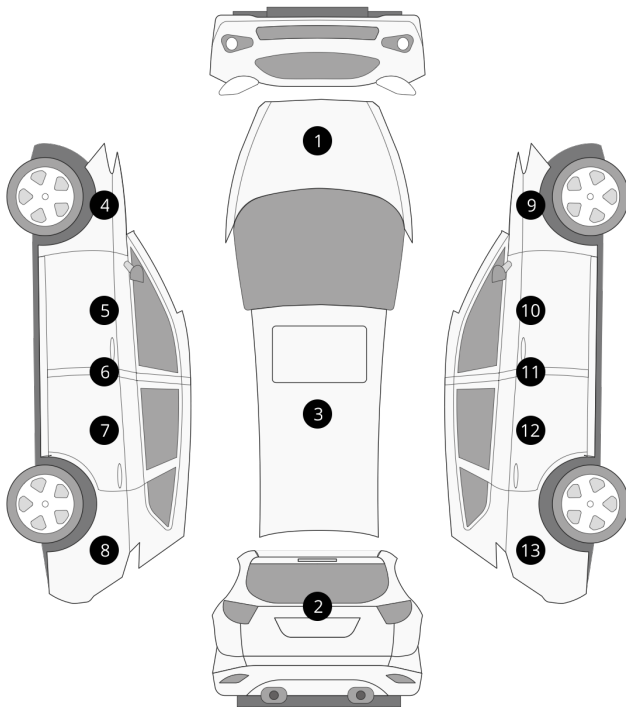


General Information

Date & Time: 01, Mar, 2024 09:22

Make	Toyota	Model	Yaris
YOM	2020	Mileage	92,742
Registration No.	AAB-174	Chassis No.	NSP150R-7002712
CC	1.3	Transmission	Automatic
Fuel Type	Petrol	Type of Body	Sedan/Saloon
Colour	Gray	Grade	undefined
Expiry Revenue license		Expiry Insurance	

Body / Panel Condition



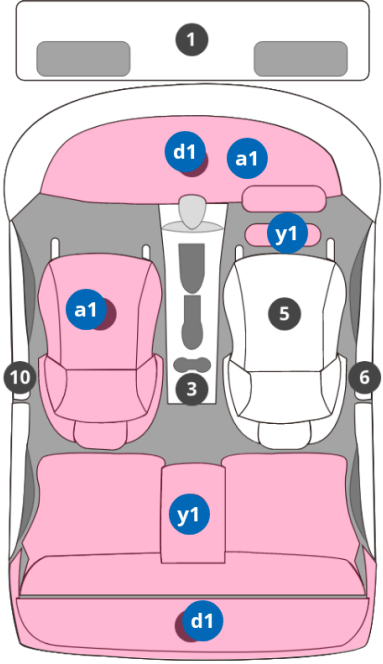
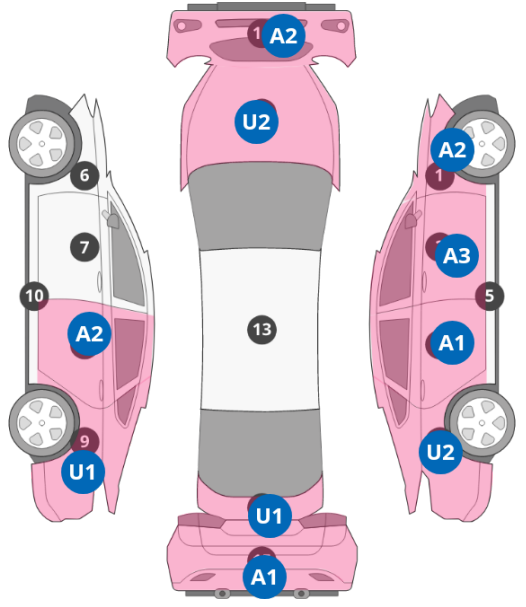
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	4.6	4	5	4
2	Boot Lid	12.9	20	9	10
3	Roof	4.3	5	4	4/4
4	Left Front Fender	4.8	5	5	5
5	Left Front Door	8.7	15	5	6
6	Center Panel Left				
7	Left Rear Door	4.5	5	5	5
8	Left Back Panel	6.0	8	5	5
9	Right Front Fender	5.0	5	5	5
10	Right Front Door	4.8	5	5	5
11	Center Panel Right				
12	Right Rear Door	6.1	5	5	9
13	Right Back Panel	3.0	5	5	0

Overall Evaluation :

B+

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B+	Exterior Evaluation : B
	
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Glove Box - Loose, Deformed, Grime - Minimal / Instrument Panel - Worn, Scratch, Cut, Crack - Minimal / Right Front Floor Lag - Grime - Minimal / Left Front Seat - Fray - Minimal / Rear Seat - Grime - Minimal / Trunk Room - Loose, Deformed, Grime - Minimal</p>	<p>Remarks Right Front Fender - Scratch - Small / Right Front Door - Scratch - Medium / Right Rear Door - Scratch - Minimal / Right Rear Fender - Dent - Small / Left Rear Door - Scratch - Small / Left Rear Fender - Dent - Minimal / Front Bumper and Grille - Scratch - Small / Bonnet, Headlight - Dent - Small / Trunk Hood, Rear Gate - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal</p>
Frame Evaluation : B+	Functional Evaluation : B+
<p>Remarks Defects not found</p>	<p>Remarks Wiper - Function - Weak</p>

Inspector Notes